

100

101

102

103

104

105

106

107

108

109

110

111

112

113

114

115

116

117

118

119

120

121

DISC 1

CB1
15 Amps

CB2
5 AMPS


PS1
DC POWERSUPPLY
2.1A @ 24VDC
OUTPUT - 24VDC 2.1A

100-240VAC


24VDC

10+ To Line 150 20-

PARAMETERS (FROM DEFAULT)	
AA101	01 SPEED INPUT SOURCE SELECTION
AA111	01 RUN COMMAND INPUT SOURCE
AC100	6.00 ACCELERATION TIME
AC120	2.00 DECELERATION TIME
BA110	3.2 LEVEL OF ELECTRONIC THERMAL OVERLOAD
CB-01	000 INPUT [1] FUNCTION
CB-02	001 INPUT [2] FUNCTION
CB-03	016 INPUT [3] FUNCTION
CB-04	017 INPUT [4] FUNCTION
CB-05	018 INPUT [5] FUNCTION
CB-06	000 INPUT [6] FUNCTION
CB-07	000 INPUT [7] FUNCTION
CB-22	01 INPUT [2] ACTIVE STATE
CB-03	8.10 I/O START DELAY
CB-31	94 AI VOLTAGE/CURRENT GAIN ADJUSTMENT
CC-07	001 ALARM RELAY FUNCTION
CB-17	001 ALARM RELAY ACTIVE STATE
HC105	90.00 MAXIMUM FREQUENCY



TIMER SETTINGS		
PARAMETER	DISPLAY	SETTING
Output operation mode	out n	on d
Time Range	t r n G	99'59 ^m
Time UP/DOWN	U - d	d n
Width of min. input signal	i n k	20
Backlight	b l U	on
Key lock	k o c k	LoFF

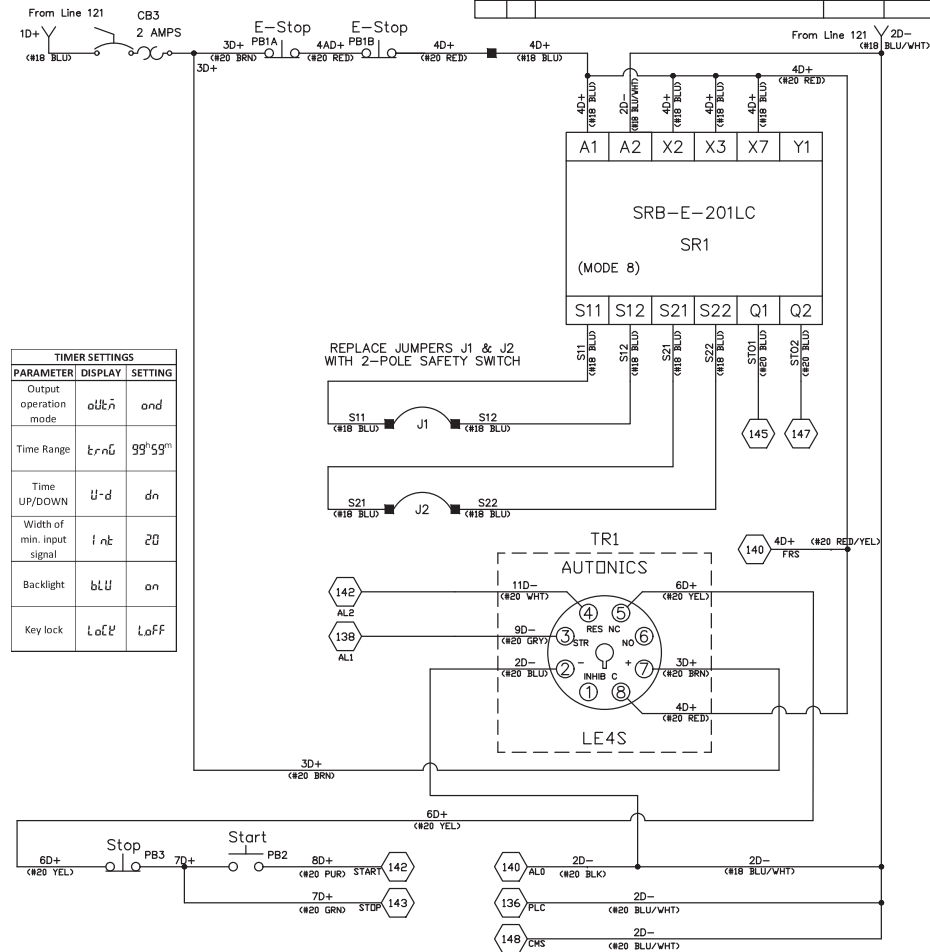

DRAWN BY PCW		103 Kuhn Rd, Syracuse, NY 13208 PHONE 315-564-4347 FAX 315-437-1029
CHECK BY PCW		
DATE DRAWN 11/20/2018		
DATE CHECKED 09/26/2025		
TITLE MORSE 5894-P (ELECTRICAL) 110-120VAC 50/60HZ 1PH 0.5HP		